

Notes on the Solar BMS SBMS4080

5.4.2017

Some years ago I've bought the solar BMS from Dacian Todea, a very smart guy from Canada, who has set up a kickstarter campaign for an open source hardware.

I chose the DIY kit.

Yesterday I've soldered the PCBs, since with my new project, the [Nachtsonne](#) I have a use for this now.

There were some issues, which I think are worth noting.

Technical Data

Power Dissipation

Without any heatsink, 6W of dissipation on the power MOSFETs is possible. With Heatsink more than 20W are possible.

PV-Input

6mV/A -> 9.6W@40A

PV-Output

2mV/A -> 0.8W@20A

Missing Parts

The DIY kit came with nearly all the necessary parts needed for the assembly. All the 1k resistor packs were missing, but I could successfully replace them with 1608 metric (0603 imperial) resistors.

Part Values

I've found 3 different versions for the part values. The probably most fitting ones are the one from the KiCad schematic from August 2014. An earlier version from May and also the PCB-file from August has more 220nF instead of the updated 1uF ceramic capacitors.

I've got also an 270R R-pack, but there was no use for it.


Orientation of the Box Header Connectors

The box headers have a pin1 designator, both on the plug and on the socket, but Dacian didn't comply with this scheme. Therefore the printings on the top of the BMS are incorrect. Changes have to be made in the schematics and on the printing on the device.

Rx and Tx

The UART is connected to external pins via opto couplers. Somehow the Tx line is without negation, and the Rx line is negated. I've fixed this with some enameled copper wire and resistors.

Fixed Version:

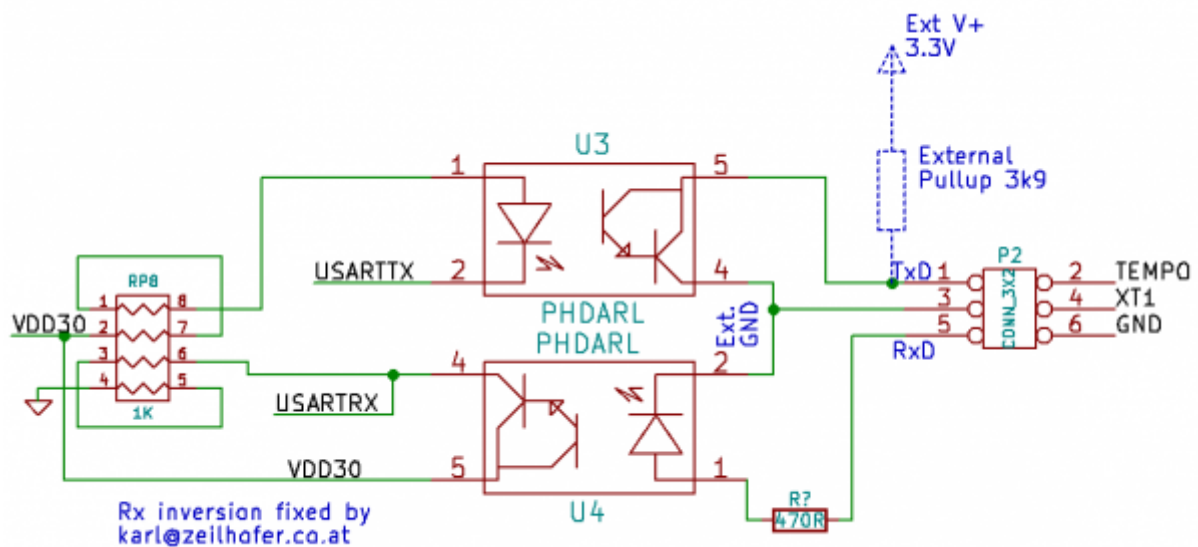



Flashing the Firmware

For flashing the firmware I've used the Rx and Tx lines, connected to the external pins¹⁾. As USB adapter I've used the FTDI converter to 3.3V UART, with an 3.9k Ohm external pullup for the BMS's Tx line.

The Boot0 pin (pin 44 of the MCU) is floating by default. For programming it has to be connected to VCC (3.0V).

As software I used the STM32 Flash Loader Demonstrator with 9.6kbit/s and 128kByte Flash size settings. Sadly this software only runs on windows.

After flashing, Boot0 pin has to be connected to GND.

Dacian [explains here](#) how to use a ST Microelectronics developmentboard to programm it via USB.

Mechanical Tolerances Mismatch of LCD

The LCD loses the signal very easy. It helps, to move the LCD as far to the North as possible before mounting the top PCB with the capacitive touch sensors. I also removed the zebra conductor from the LCD and cleaned all surfaces with „Kontaktspray“. Since then there was no problem any more.

¹⁾

they have been fixed, see [Rx_and_Tx](#)

From:

<http://www.zeilhofer.co.at/wiki/> - **Verschiedenste Artikel von Karl Zeilhofer**

Permanent link:

<http://www.zeilhofer.co.at/wiki/doku.php?id=sbms4080&rev=1491803267>

Last update: **2017/04/10 07:47**

